

A FLECK PERFORMANCE BULLETIN

Product Application Service General **news from Fleck Controls**

May 13th, 1998

Reminder – 5000 Clutch Lubricant Improvement

In January 1997, our application bulletin described the change in Fleck's use of an oil lubricant in place of grease on the 5000-control drive motor. This change began with valve serial number 3920216.

This change improves the life expectancy of the clutch and prevents any failures due to oxidation of the grease.

There are two symptoms of the former grease oxidation problem. Either the valve position knob will not stop rotating or the valve fails to return to the service position to complete the regeneration cycle.

Check the serial number first. It is not necessary to return the control valve to Fleck for repair. Simply replace the motor and return the motor to Fleck for replacement or credit. This, in most cases, will correct the problem.

As always, thank you for using Fleck Controls.

Sincerely,

Fleck Controls, Inc.
Technical Product Support