



# PERFORMANCE BULLETIN

Product     Application     Service     General    news from




March 20, 2000

## 2310 Safety Brine Valve Material Changes

### Retainer

The material of the 2310 valve drain retainer (part #18312) was changed from Acetyl to Noryl in May '99 because of chemical attack. The new Noryl retainer can be identified by a capital "N" on one side of the retainer. See details in the photo below.

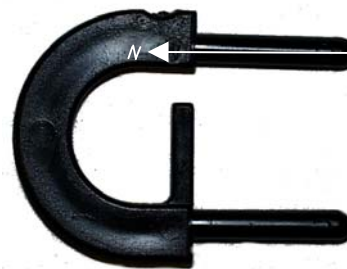

The "N" is indicated here in white, for illustration purposes only. It is actually the same color as the retainer.

### Gripper

We received reports of the disintegration of the gripper in the plastic nut assembly. We are changing the gripper to the more resistant material Kynar. The new gripper will be black in color and will be included in shipments in the nut assembly (Part # 19625) starting July 1, 2000. The current material used is Acetyl. If you are experiencing deterioration of the gripper in the nut assembly, we have the Kynar gripper available until we are in production July 1, 2000.



This is the Acetyl gripper in the nut assembly. The new Kynar part will be black.

As always, thank you for using Fleck controls.

Sincerely,  
Pentair Water Treatment, Inc.

Jay Runkle  
Technical Product Support